



Philips Pressurised steam generator GC8330/02 180 g steam boost 5 bar SteamGlide with Detachable water tank
GC8330/02

Service information

[Print this page](#)

[Back to Service Information](#)

Reference no.: SDA_97593

Symptom

1W and 0.5W Power Board and Control Board

Cure

Typical symptoms or complaints: Service center have 2 type of Power Board (4239 021 31970) and (4239 021 73241)

Products affected: GC82xx, GC83xx

Root causes:

Power Board PCB Assy upgraded from 1W to 0.5W standby power..

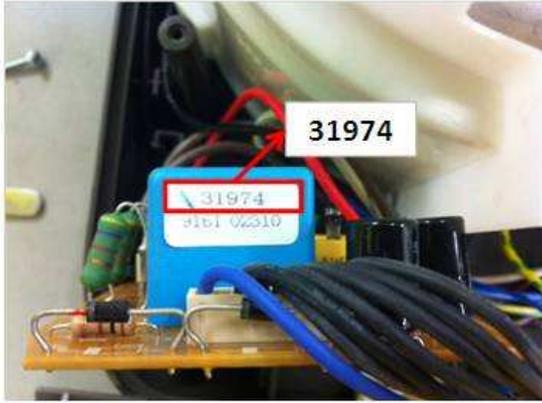
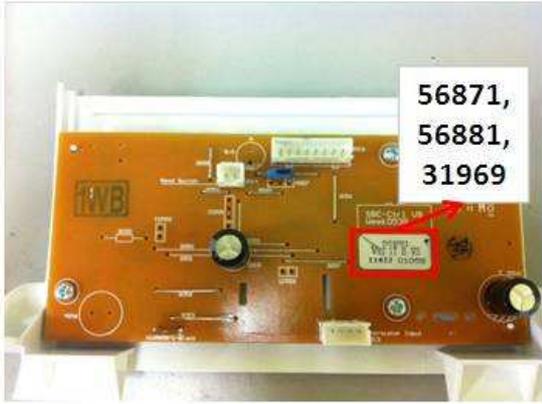
Symptom Cure:

Refer to the repair options shown below.

CTN	Return set GC82xx, GC83xx	Repair option
GC82xx, GC83xx	**If Control Board PCBA Assy (Pos 44) is 4239 021 56871 or 4239 021 56881 or 4239 021 31969	Option 1* Pos 43: Replace Power Board PCBA Assy, 4239 021 31970 Option 2 (Must replace both Power Board and Control Board) Pos 43: Replace Power Board PCBA Assy, 4239 021 73241 and Pos 44: Replace Control Board PCBA Assy, 4239 021 73231
	If Control Board PCBA Assy (Pos 44) is 4239 021 73231	Option 3 Pos 43: Replace Power Board PCBA Assy, 4239 021 73241

* If Repair Option 1 Power Board PCBA Assy, 4239 021 31970 is not available, pls use Repair Option 2.

To identify OLD/ NEW Power Board and Control Board:

	Power Board	Control Board
OLD	 <p>31974</p> <p>31974 3161 02310</p>	 <p>56871, 56881, 31969</p>
NEW	 <p>73241</p> <p>31977 12091902550</p>	 <p>73231</p>

Attachments

File name	File size	File date	Language
Shanghai Power_Control Board_OLD NEW.pdf	562KB	2013-03-25	English