

YAMAHA Music Europe GmbH

DVX-1000 (DVR-1000)

February 2012 Date:

Number: 09.12ce 1/2


Substitue Parts Introduction for Traverse Unit

PURPOSE:

Under current stock shortage of loader ass'y for DVX-1000, alternative solution to replace only with traverse unit which is one assembly part of loader ass'y is introduced. The substitute traverse unit is compatible with original one.

- PROCEDURE: 1) Remove 4 screws mounting traverse unit in "WQ467000" together with cable and cushion rubber. (Fig 1)
 - 2) Replace original traverse installed in the loader ass y for DVX-1000 with the substitute traverse unit removed from "WQ467000". (Fig 2)
 - Note> Original screws and cushion rubbers in DVX-1000 should be used.
 - 3) Be sure to remove solder short for electrostatic damage prevention. (Fig 3)
 - 4) Other procedure is the same as instructed in service manual.

DVD MECHANISM UNIT (WQ467000)

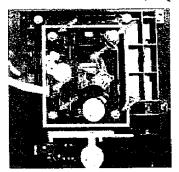


: Screw, Cushion rubber

: Cable


(Fig 1)

LOADER ASS'Y for DVX-1000

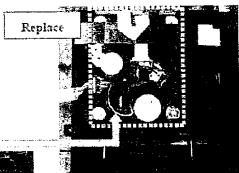

Remove

Traverse Unit (Fig 2)

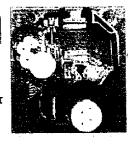



(Fig 3)